

Applies To: **See VEHICLES AFFECTED****June 7, 2005****Child Seat Anchor Locating Button Is Missing****(Supersedes 05-016, dated May 12, 2005, to update the information marked with the black bar)****PROBLEM**

The small button on the rear seat-back cover that marks the location of each child seat LATCH lower anchor is missing.

VEHICLES AFFECTED**2001–05 Accord – ALL****2001–05 Civic – ALL****2003–05 Civic Hybrid – ALL****2002–05 Civic Si – ALL****2001–05 CR-V – ALL****2003–05 Element – ALL****2001–05 Odyssey – ALL****2003–05 Pilot – ALL****CORRECTIVE ACTION**

Replace the button.

NOTE: Older vehicles have buttons without a child seat icon. The buttons in newer vehicles and the replacement buttons all have an icon. If your customer requests matching buttons, replace all the buttons at the same time as a set.

PARTS INFORMATION

Child Seat ISOFIX Button Kit:

(Kit contains buttons in nine different colors; 10 buttons of each color.)

P/N 070AZ-SHJA190, H/C 7979016

Child Seat ISOFIX Button Kit Replacement Parts:

NOTE: For color information, refer to PIB A05-0005, *Child Seat Anchor Locating Buttons*. Click **PARTS**, then click **PARTS LIBRARY**, then click **Parts Bulletins**. Select **Child Seat Anchor Buttons** from the list.

(Each part contains fabric washers, button posts, and back portions.)

NH167L (30 pieces):

P/N 82123-SDA-305ZA, H/C 7643323

NH490L (30 pieces):

P/N 82123-SDA-305ZB, H/C 7646961

YR164L (30 pieces):

P/N 82123-SDA-305ZC, H/C 7643331

B94L (30 pieces):

P/N 82123-SDA-305ZD, H/C 7651490

G48L (30 pieces):

P/N 82123-SDA-305ZE, H/C 7835028

NH595L (30 pieces):

P/N 82123-SDA-305ZF, H/C 7835036

NH283L (30 pieces):

P/N 82123-SDA-305ZG, H/C 7835044

YR295L (30 pieces):

P/N 82123-SDA-305ZH, H/C 7835051

YR312L (30 pieces):

P/N 82123-SDA-305ZJ, H/C 7835069

WARRANTY CLAIM INFORMATION

In warranty: The normal warranty applies.

OP#	Description	FRT
8530W6	Replace button: Civic, Civic Si, CR-V, Element, Odyssey	0.2
	Replace button: Pilot, Accord	0.3
	Replace button: Civic Hybrid	0.4
8530W6A	Replace additional button	0.1

Failed Part: 82123-SDA-305ZA

Defect Code: 07801


Symptom Code: 03220

Skill Level: Repair Technician

Out of warranty: Any repair performed after warranty expiration may be eligible for goodwill consideration by the District Parts and Service Manager or your Zone Office. You must request consideration, and get a decision, before starting work.

REPAIR PROCEDURE

1. Remove the rear seat-back cover just enough to allow access to the opening where the button will be attached:
 - Refer to Section 20, Rear Seat-back Cover Replacement, in the appropriate service manual, or
 - Online, enter keyword **SEAT COVER**, and select the appropriate **Rear Seat-back Cover Replacement** procedure from the list.
2. Select the appropriate button from the Child Seat Anchor Service Set.
3. Attach the button to the rear seat-back cover:
 - Place a fabric washer over the button post.
 - Insert the post through the opening in the cover.
 - Snap the back portion onto the post.

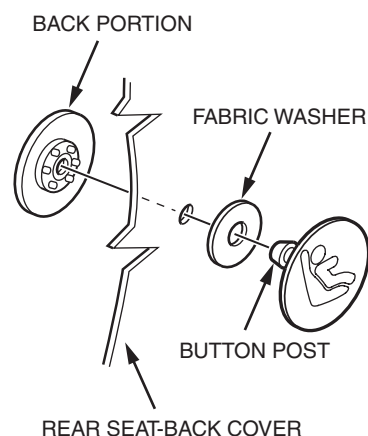

4. Repeat steps 2 and 3 as needed for additional buttons.
5. Install the seat-back cover in the reverse order of removal.